

Work Order ID 126941***126941***

Tuesday, December 02, 2014 10:53:36 AM

Page 1

Item ID: D119-796-241TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 12/2/2014 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 12/2/2014 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: MLJ Date: 14-12-02 Tooling: _____ Date: _____Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D119-796-241	B
--------------	---

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs on both ends as per Folio FB298

2-Turn first side as per Folio FB298

3-Blend transition lines only, **do not sand whole tube**:

FOLIO REV: N/ADWG REV: C

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

1 ϕ _____
mm L
15/01/08

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Memo

0.00

Quality Control

1 ϕ _____
mm L
15/01/08

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
--	--	---

☐ Outside Dimensions
☐ Over/Under tolerance
☐ Part Incorrect
☐ Part Lost/Missing
☐ Part Moved
☐ Positioned Wrong
☐ Power Loss/Surge

☐ Pressure/Forced
☐ Set-up
☐ Temperature/Cure
☐ Weld
☐ Wrong Stock Pulled
☐ Other

Work Order ID 126941

Tuesday, December 02, 2014 10:53:36 AM

126941

Page 2

Item ID: D119-796-241TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Item Name: Crosstube Turning Detail

Stop

NS2

Start Date: 12/2/2014 Start Qty: 1.00

1

Cust Item ID:

Required Date: 12/2/2014 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

120

120

Mori Seiki

Mori Seiki CNC Lathe Large

MORI SEIKI CNC LATHE LARGE

Memo

1-Turn second side as per Folio FB298

2-Blend transition lines only, **do not sand whole tube**:

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

FOLIO REV: N/A

DWG REV: C

3-Remove sand and plugs

4- scribe batch # and part # as per dwg

0.00

0.00

1 0

mmc
15/01/14

130

130

QC

Quality Control

QC1- Inspect dimensions to dimension sheet

Memo

0.00

0.00

1 0

mmc
15/01/14

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 126941

Tuesday, December 02, 2014 10:53:36 AM

126941

Page 3

Item ID: D119-796-241TRN Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Crosstube Turning Detail
 Start Date: 12/2/2014 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 12/2/2014 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC8- Inspect parts - second check	0.00						DAS	
140						1	0	47	
QC	Memo	0.00						9-89	
Quality Control								15-01-14	
145		0.00							
145									
Crosstubes	Memo	0.00							JW 15-01-14
Crosstubes	GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.								
150		0.00							
150									
HandFXtube	Memo	0.00							JW 15-10-15
Hand Finishing Crosstubes	1- PRESSURE WASH X-TUBE INSIDE AND OUT								
	2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE								

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 126941

Tuesday, December 02, 2014 10:53:36 AM

126941

Page 4

Item ID: D119-796-241TRN Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Crosstube Turning Detail
 Start Date: 12/2/2014 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 12/2/2014 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	QC5- Inspect part completeness to step on W/O	0.00							DAG 38 9-89
160									
QC	Memo	0.00							
Quality Control									15-01-15
170	Packaging	0.00							
170									
Packaging	Memo	0.00							JW 15-01-16
Packaging	Identify and stock in kanban rack								
	Location: LG								
180	QC21- Final Inspection - Work Order Release	0.00							
180									
QC	Memo	0.00							MLS 15-01-15
Quality Control									

(Signature) 15-15

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

Tuesday, December 02, 2014 10:53:39 AM

Page 1

Work Order ID: 126941

126941

Parent Item: D119-796-241TRN

D119-796-241TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 12/2/2014

Required Date: 12/2/2014

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP REV A RQ 14/05/27 VERIFIED BY DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D6009-129

Manufactured No

100

Each

70.5000

1

1

D6009-129

Crosstube Material

Location

Loc Qty

Loc Code

LG003

70.5

107864

27.5

107865

39

75627

3

75648

1

mm L 15/01/07

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge	☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--	--

DART AEROSPACE LTD		Work Order: 126941
Description: Crosstube Assembly		Part Number: D119-796-2Y1TRN
Inspection Dwg: D119-796- Rev: C		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet Drawing Dimension		Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A							
	2.500	± 0.005	2.498	/		vern	CNC-05
	2.626	± 0.005	2.624	/			
	2.627	± 0.005	2.628	/			
	2.798	± 0.005	2.798	/			
	2.799	± 0.005	2.802	/			
	2.989	± 0.005	2.993	/			
	3.191	± 0.005	3.194	/		mic	CNC-05
	3.200	± 0.005	3.201	/		mic	
SIDE B							
	2.500	± 0.005	2.499	/		vern	CNC-08
	2.626	± 0.005	2.625	/			
	2.627	± 0.005	2.628	/			
	2.798	± 0.005	2.799	/			
	2.799	± 0.005	2.802	/			
	2.989	± 0.005	2.993	/			
	3.191	± 0.005	3.192	/		mic	CNC-05
	3.200	± 0.005	3.197	/		"	
	105.730	± 0.020	105.730	/		tape	LG-11

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																


Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

DART AEROSPACE LTD		Work Order:	126941
Description: Crosstube Assembly		Part Number:	
Inspection Dwg:	Rev:		
		Page 2 of 2	

WALL THICKNESS MEASUREMENT

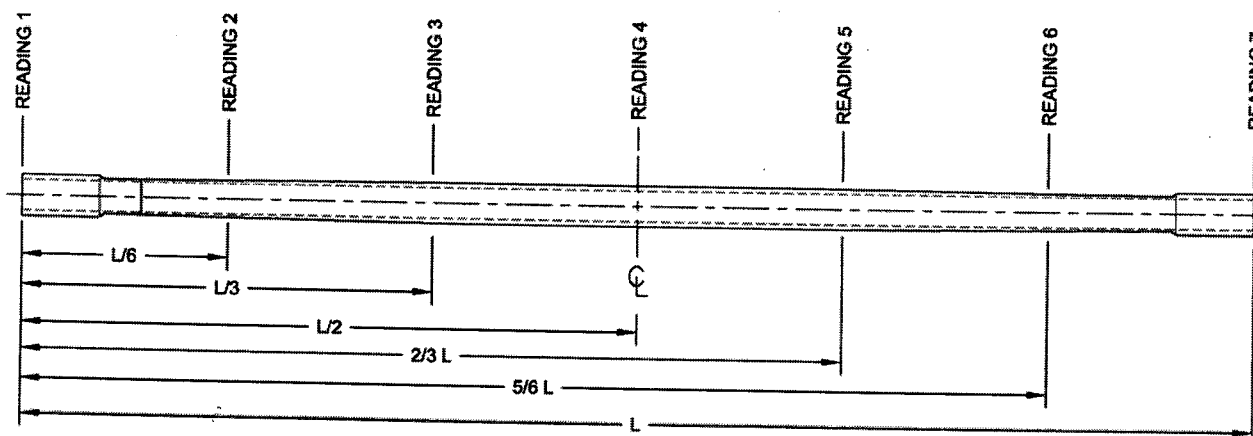

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.136	.127	.134	.140	.013	
READING 2 L= 17	.219	.210	.209	.211	.010	
READING 3 L= 35	.319	.316	.317	.321	.005	
READING 4 L= 52	.487	.482	.484	.491	.009	
READING 5 L= 69	.345	.319	.314	.338	.031	
READING 6 L= 87	.234	.221	.224	.233	.013	
READING 7 L= 105	.127	.132	.139	.130	.012	

Calibration Result

Actual Block Thickness: .100 - .250

SITESCAN 250 Measured Thickness: .100 - .750

DAS
47

Measured by:	mml
Date:	15/01/14

Audited by:	9-89
Date:	15-01-14

Preliminary Approval:	
Date:	

Rev	Date	Change	Revised by	Approved
B	10.04.14	Added preliminary approval	KJ	
C	12.06.01	Wall thickness form added	KJ	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other

ITEM	QTY	P/N	DESCRIPTION
	X	D119-796-241	XTUBE ASSY (AW119 MKII AFT)
1	1	D119-796-241BND	CROSSTUBE, AFT
2	4	D2873-043	RADIUS BLOCK
3	1	D5122-1	CENTER SUPPORT
4	6	D5123-1	CLAMP CUSHION
5	2	D5123-5	CLAMP CUSHION
6	1	D5134-041	DAMPER SUPPORT ASSY, LH
7	1	D5134-042	DAMPER SUPPORT ASSY, RH
8	1	D5136-1	CONTACT PAD, LH
9	1	D5136-2	CONTACT PAD, RH
10	16	CR3212-4-07	RIVET, BLIND CSK
11	6	MS21920-25	CLAMP
12	2	MS21920-28	CLAMP

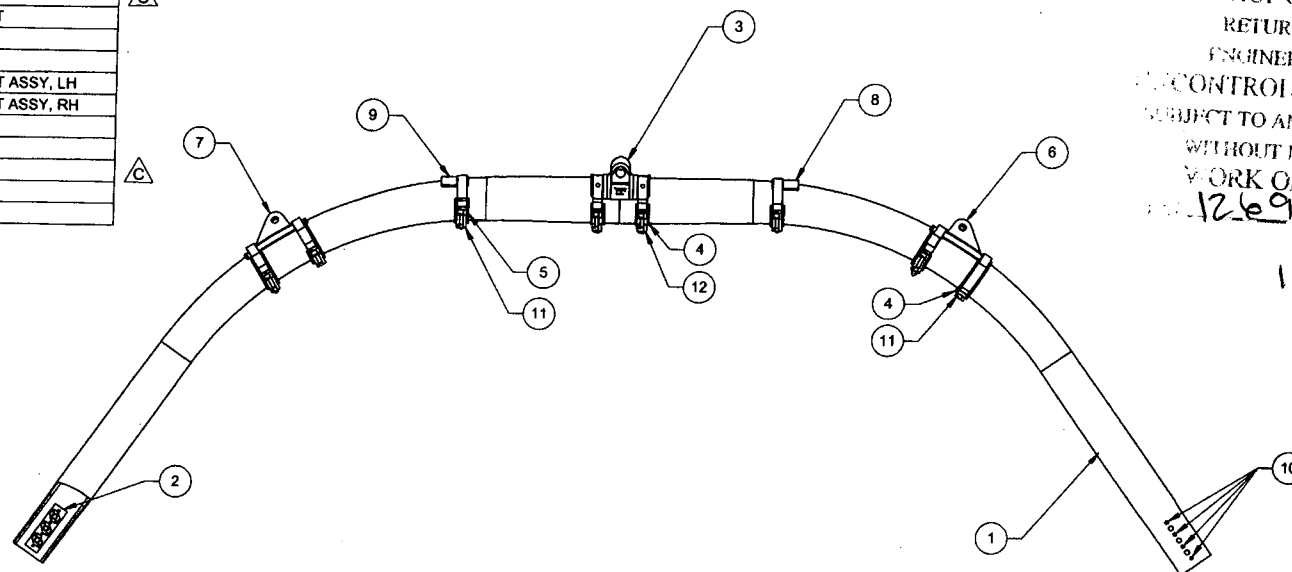

D119-796-241 XTUBE ASSY (AW119 MKII AFT)

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY USING PART NUMBER "D119-796-241" AND BATCH NUMBER ON INSIDE OF CUFF PER QSI 044 6.4
- 7) WEIGHT: 26.26 lbs
- 8) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM DEFECTS SUCH AS SCRATCHES, NICKS OR DENTS. DEFECTS UP TO 0.005 MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 9) INSTALL D5122-1 CENTER SUPPORT AT 8.4" OFFSET FROM THE CROSSTUBE BENDING PLANE USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. ENSURE OFFSET IS AS PER NOTE 13. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER DP460 HAS CURED FOR 24 HOURS.
- 10) ABRASE MATING SURFACES OF D5136-1/-2 AND SURFACE OF CROSSTUBE WITH 180 GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.100" MIN THK LAYER OF PROSEAL 890 ON THE INSIDE CONCAVE SURFACE OF THE D5136-1/-2 CONTACT PADS AND INSTALL AT AN 8.4" OFFSET FROM THE CROSSTUBE BENDING PLANE. INSTALL MS21920-25 CLAMPS AND D5123-1 CLAMP CUSHIONS WHILE WET. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.
- 11) TORQUE MS21920 CLAMPS 80 - 100 IN.-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY. THE NUT HAS NOT BOTTOMED-OUT AFTER TORQUING AND THE NUT IS FACING AFT.
- 12) POSITION AND INSTALL D5134-041/-042 DAMPER SUPPORTS USING JIG DT10085. ABRASE MATING SURFACES OF THE D5134-041/-042 DAMPER SUPPORTS AND CROSSTUBE WITH 180 GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.100" MIN THK LAYER OF PROSEAL 890 ON THE INSIDE CONCAVE SURFACE OF THE D5134-041/-042. INSTALL MS21920-25 CLAMPS AND D5123-1 CLAMP CUSHIONS WHILE WET. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SHOP COPY
RETURN TO
ENGINEER
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
12-6941 M05

14-12-02

RELEASED
2014-11-18
MD

C	CR3212-4-07 RIVETS WAS CR3212-4-05 RIVETS. RADIUS BLOCK WAS NUT PLATE ASSEMBLY (BOM). REMOVED 7.5 DEG CUFF HOLE OFFSET (A1-3). REDUCED CUFF DIA TO 2.500 (C8-5). ADD INSPECTION WINDOW	AP	14.10.23
B	ORIENTATION OF D5122-1 CENTER SUPPORT WAS CORRECTED. D5123-5 ADDED UNDER D5136-1/-2 CONTACT PADS. ADDED D2873-043 NUT PLATE ASSY & CR3212-4-05 RIVETS. ADDED REFERENCE TO SKIDTUBES FOR LOCATING CUFF HOLES. RE-ORGANIZED NOTES. REMOVED REDUNDANT INFORMATION.	AP	14.09.08
A	NEW ISSUE	AP	14.08.07
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AP		
CHECKED	CP	DRAWING NO.	REV. C
MFG. APPR.	JLM	D119-796-241	SHEET 1 OF 6
APPROVED	MP	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT) NTS	
DATE	14.10.23	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

APPROVED

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

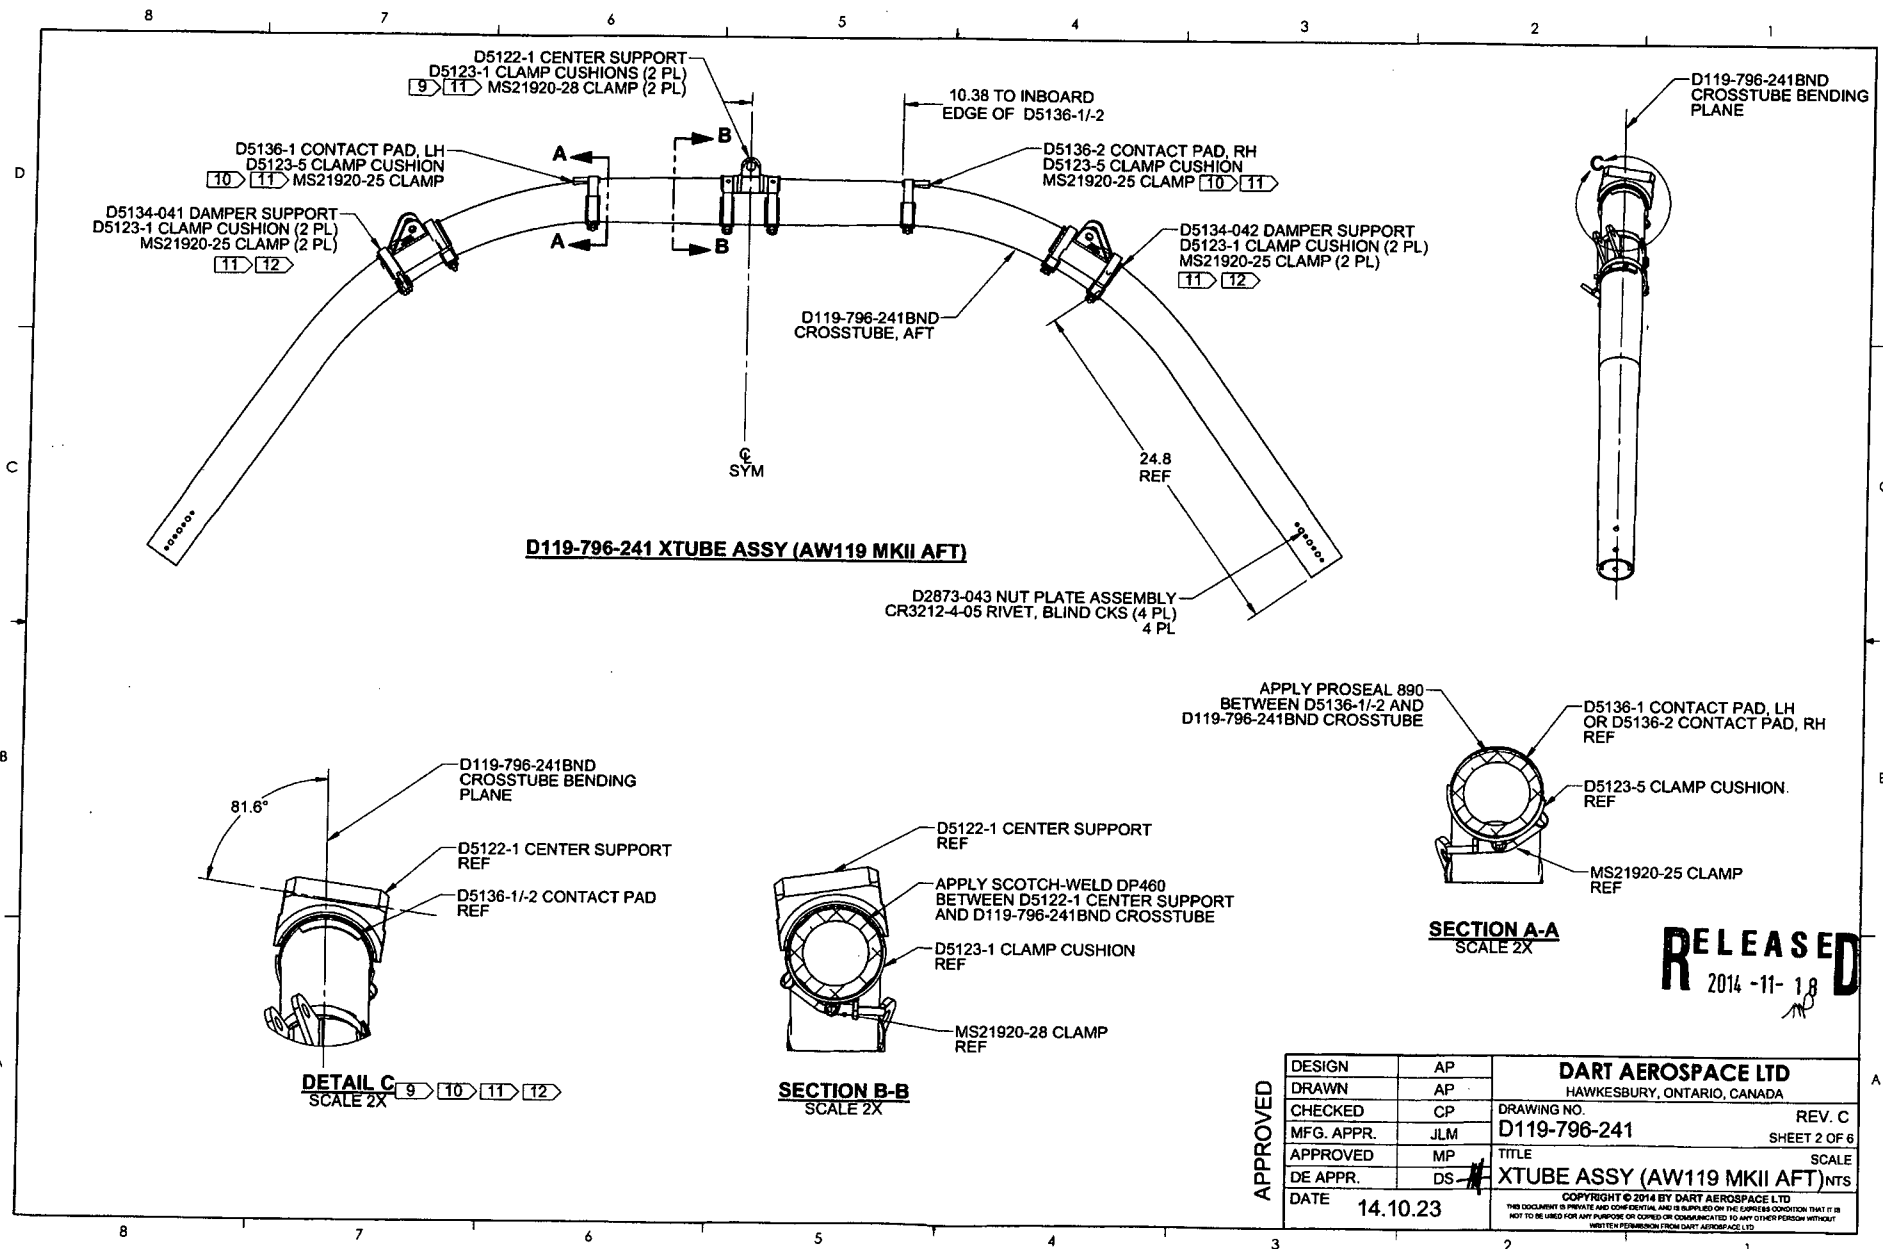

DESIGN	AP	DART AEROSPACE LTD	
DRAWN	AP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	CP	DRAWING NO.	REV. C
MFG. APPR.	JLM	D119-796-241	SHEET 2 OF 6
APPROVED	MP	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	14.10.23	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

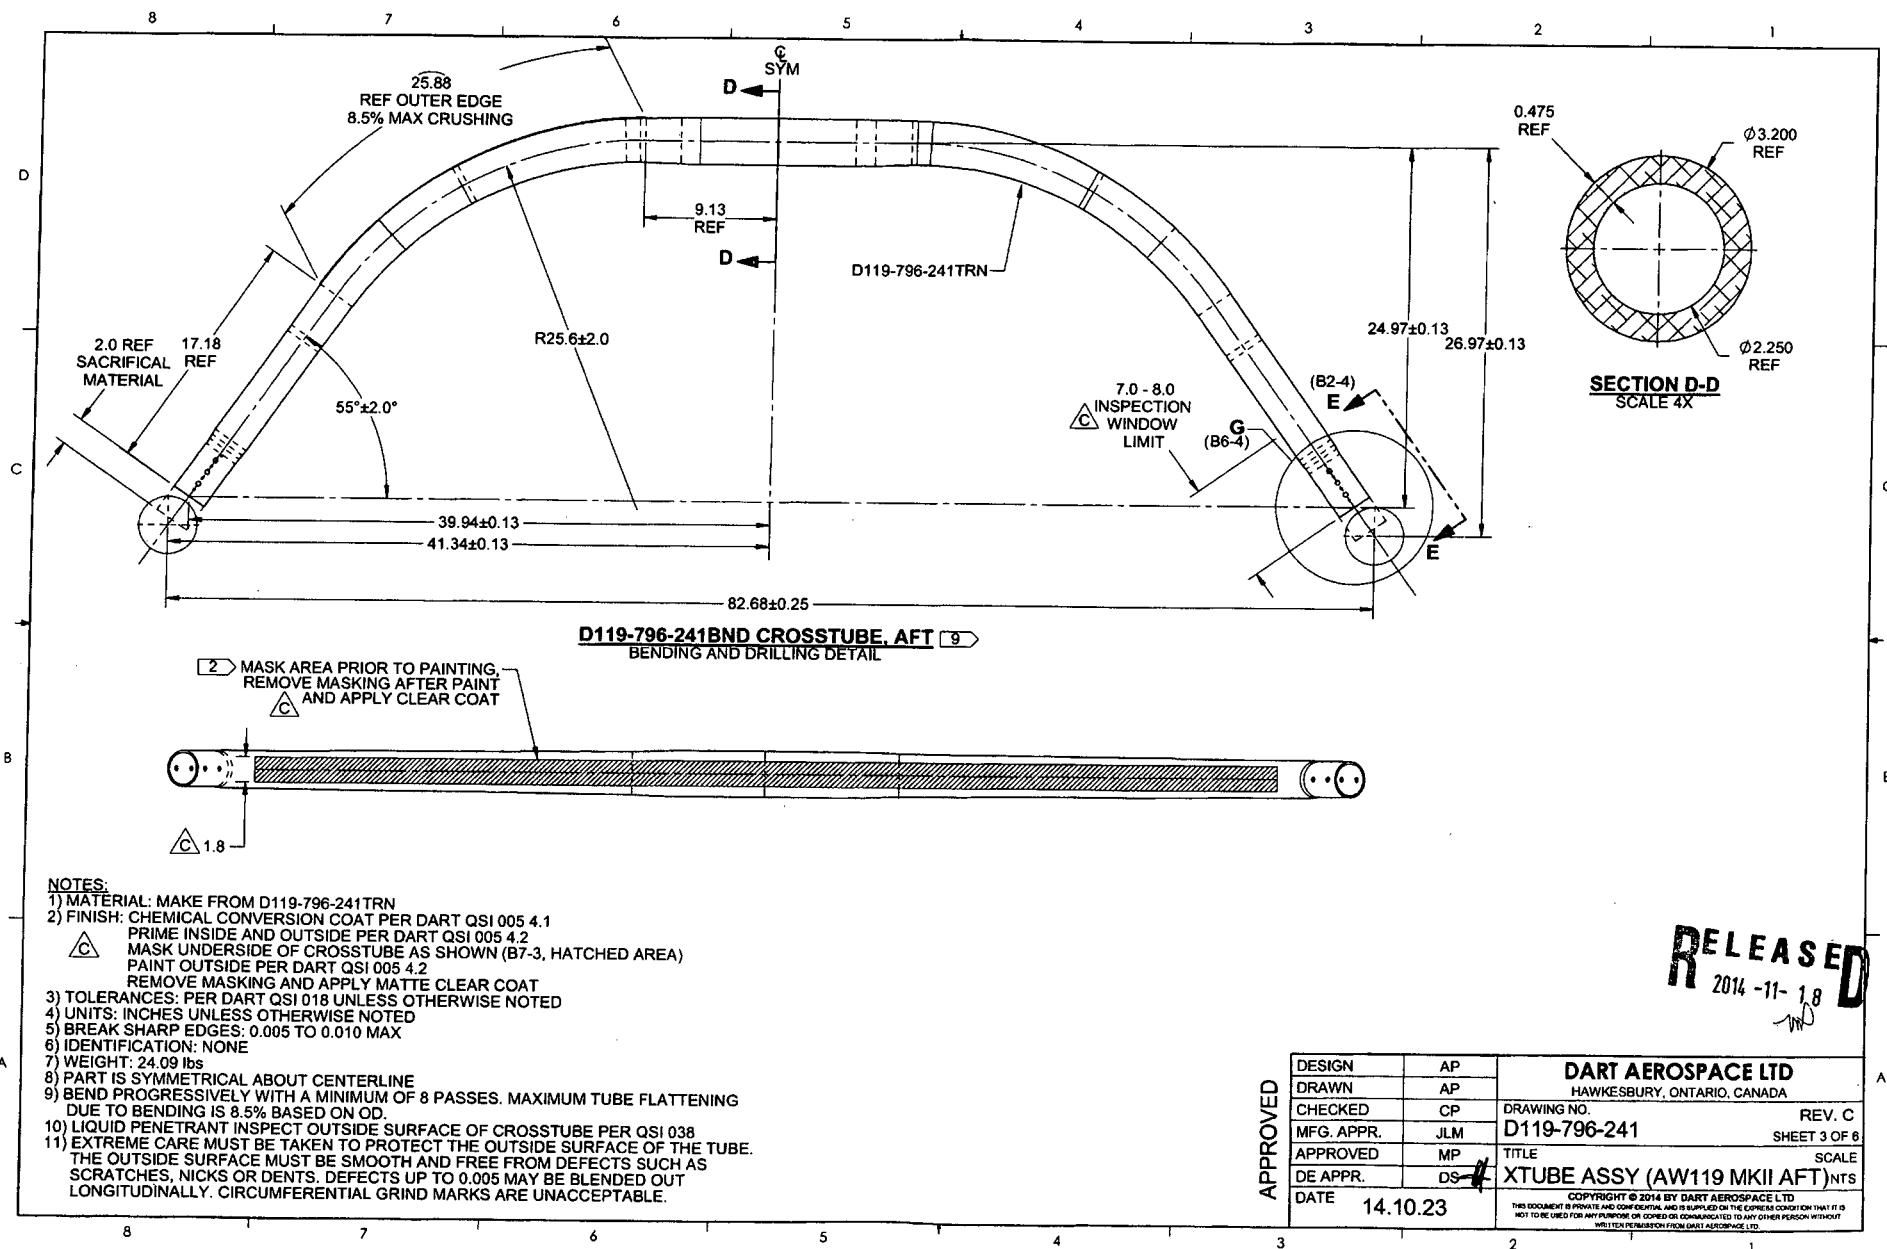

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____



Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

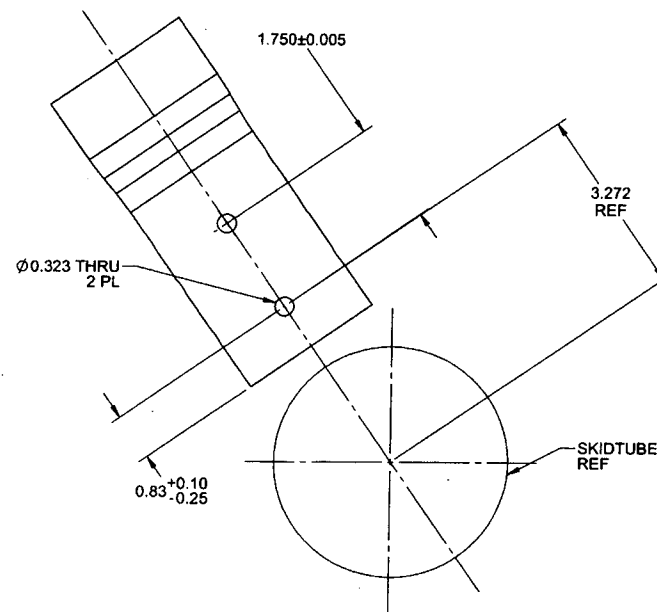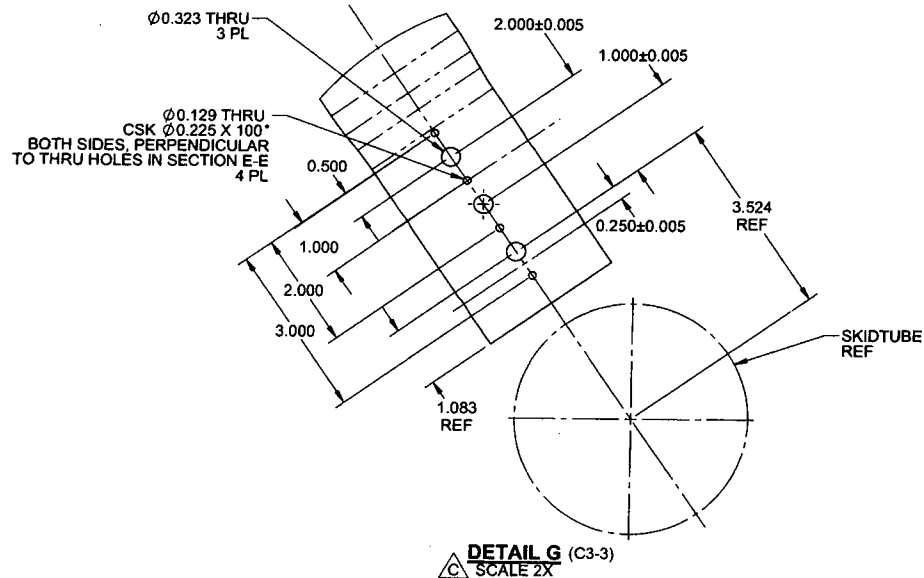

RELEASED
2014-11-18

APPROVED	DESIGN	AP	DART AEROSPACE USA, INC. KENT, WA	
	DRAWN	AP		
	CHECKED	CP	DRAWING NO.	REV. C
	MFG. APPR.	JLM	D119-796-241	SHEET 4 OF 6
	APPROVED	MP	TITLE	SCALE
	DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
	DATE	14.10.23	COPYRIGHT © 2014 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED BY COMMUNICATING TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

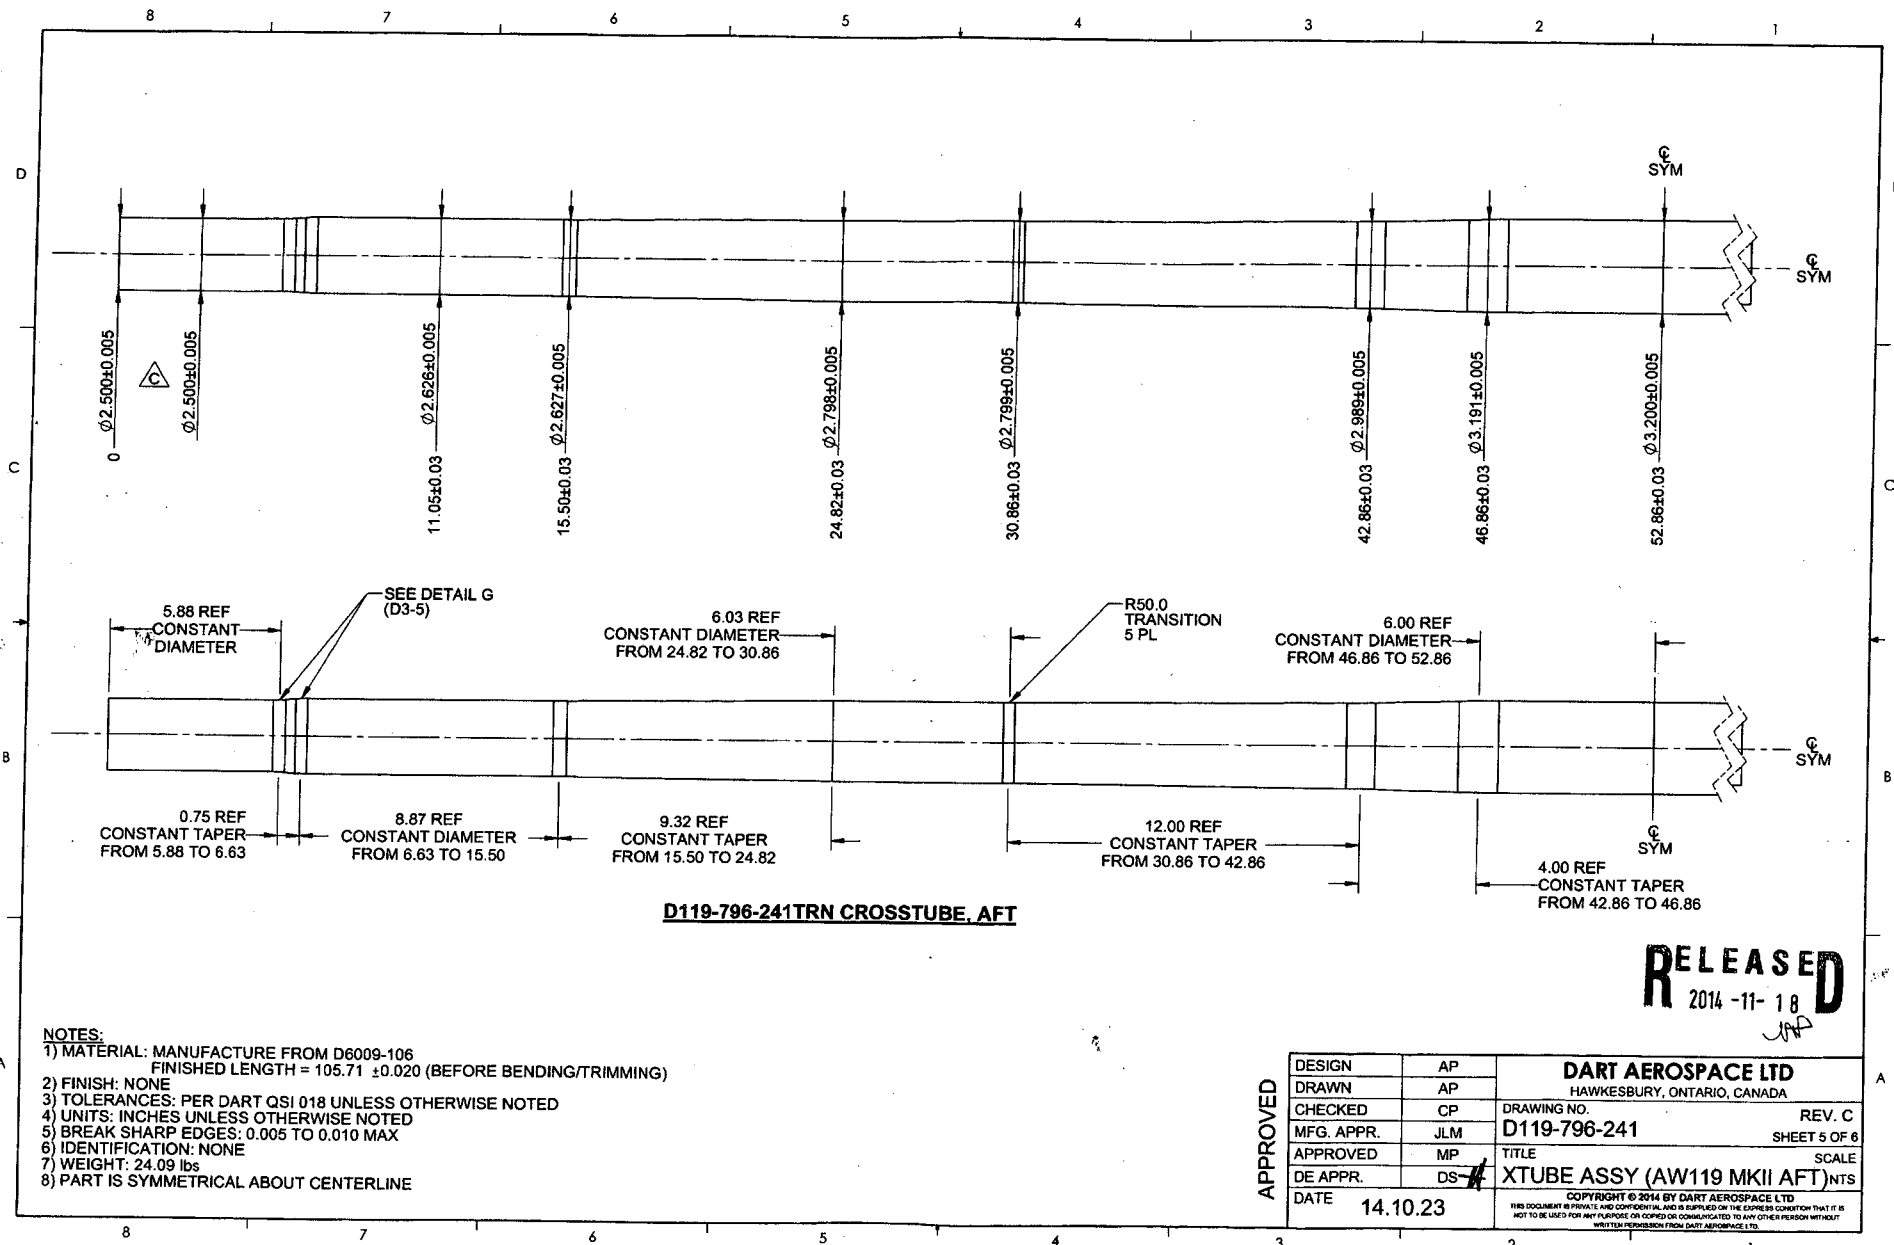

D119-796-241TRN CROSSTUBE, AFT

RELEASED
2014-11-18

APPROVED	DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
	DRAWN	AP		
	CHECKED	CP	DRAWING NO.	REV. C
	MFG. APPR.	JLM	D119-796-241	SHEET 5 OF 6
	APPROVED	MP	TITLE	SCALE
	DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT) NTS	
	DATE	14.10.23	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																


Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY


Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other

CHAMFER AS
REQUIRED FOR
TOOLING

DETAIL H
SCALE 4X

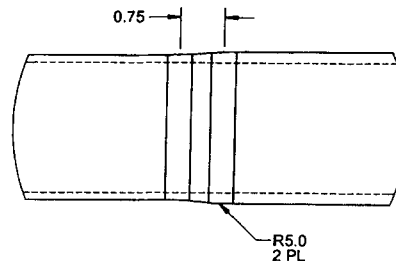

DETAIL G
SCALE 2X

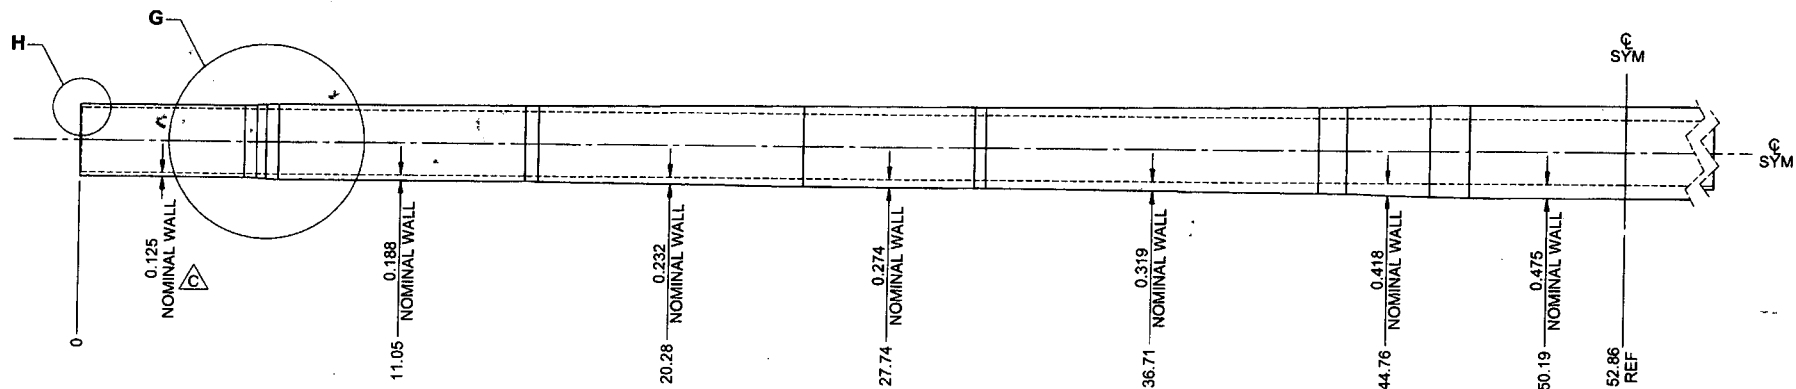

D119-796-241TRN CROSSTUBE, AFT
AUXILIARY VIEW: NOMINAL WALL THICKNESS

RELEASED
2014-11-18

APPROVED

DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AP		
CHECKED	CP	DRAWING NO.	REV. C
MFG. APPR.	JLM	D119-796-241	SHEET 8 OF 8
APPROVED	MP	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT) NTS	
DATE	14.10.23	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR OWNED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--